




CN3030 传感器参数

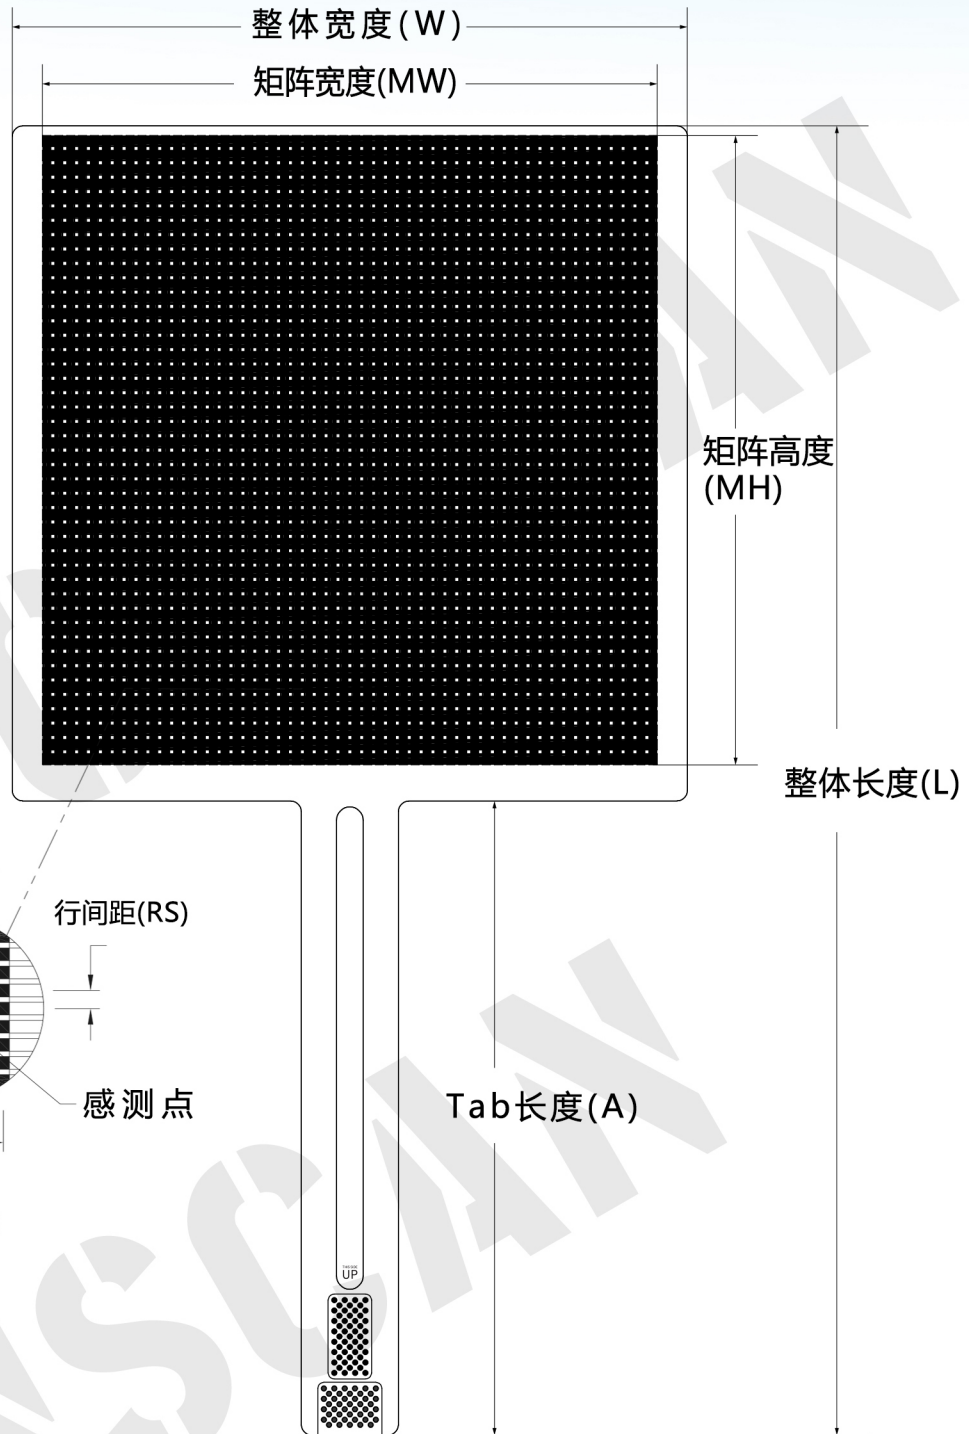

kpa	69
psi	10

外形尺寸

传感区参数

总计

整体长度 <i>L</i>	整体宽度 <i>W</i>	Tab长度 <i>A</i>	整体厚度 <i>T</i>	矩阵宽度 <i>MW</i>	矩阵高度 <i>MH</i>	列			行			感测点总数量	单位面积感测点数量 (感测点/cm ²)
						列宽 <i>CW</i>	列间距 <i>CS</i>	数量 <i>Qty.</i>	行宽 <i>RW</i>	行间距 <i>RS</i>	数量 <i>Qty.</i>		
(mm) 640	(mm) 330	(mm) 310	(mm) 0.2	(mm) 300	(mm) 307	(mm) 3.8	(mm) 5.8	52	(mm) 5	(mm) 7	44	2288	2.5
(in) 25.2	(in) 13	(in) 12.2	(in) 0.008	(in) 11.81	(in) 12.09	(in) 0.15	(in) 0.228	52	(in) 0.197	(in) 0.276	44	2288	15.9

